

# epoch home report



5 Shandon Crescent  
Edinburgh  
EH11 1QE  
30/01/2026

# Home Report Index

1. Single Survey
2. Energy Report
3. Property Questionnaire

# Single Survey

survey report on:

<b>Property address</b>	5 Shandon Crescent, Polwarth, Edinburgh, EH11 1QE
<b>Customer</b>	Mr & Mrs Prosser
<b>Customer address</b>	
<b>Prepared by</b>	Graham + Sibbald
<b>Date of inspection</b>	22nd January 2026

**GRAHAM + SIBBALD**

# Terms and Conditions

## PART 1 - GENERAL

### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property<sup>1</sup>.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

<sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

# Terms and Conditions

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

## 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

## 1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

## 1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.<sup>2</sup>

## 1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

<sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

# Terms and Conditions

they assign the same to any other party in writing.

## 1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

## 1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

## 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

## 1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is *the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*;
- the "Property" is the property which forms the subject of the Report;

# Terms and Conditions

- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

## PART 2 - DESCRIPTION OF THE REPORT

### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

# Terms and Conditions

## 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

**WARNING:** If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

## 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

## 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

## 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

## 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

*"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein*

# Terms and Conditions

*the parties had each acted knowledgeably, prudently and without compulsion.* In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

*"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).*

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

# Single Survey

## 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

<b>Description</b>	The property comprises a two storey mid terrace house.
<b>Accommodation</b>	Ground Floor: Entrance Vestibule, Hallway, Living Room, Kitchen/Dining and Utility Room  Hallway Half Landing: Bathroom  First Floor: Hallway Landing, 3 Bedrooms and Box Room off Bedroom.
<b>Gross internal floor area (m<sup>2</sup>)</b>	113 approximately.
<b>Neighbourhood and location</b>	The property is located within the Polwarth area of Edinburgh located to the west of Edinburgh city centre where surrounding properties are broadly similar in terms of age, type and character. All local facilities and amenities can be found nearby.
<b>Age</b>	1880 or thereby
<b>Weather</b>	It was raining at the time of inspection.
<b>Chimney stacks</b>	<b>Visually inspected with the aid of binoculars where appropriate.</b>  The chimneys are of stone construction and the flashings are of metal and cement design.
<b>Roofing including roof space</b>	<b>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</b>  <b>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.</b>  <b>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.</b>

# Single Survey

<b>Roofing including roof space</b>	<p><b>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</b></p> <p>The roof is of a double pitched design with the central flat section. The pitched sections are overlaid in slate with the flat section assumed to be overlaid in a felt or similar waterproof membrane material. No inspection of the flat roof structure.</p> <p>The utility off-shoot to the rear is of a flat felt design.</p> <p>Access afforded to the roof space via the hatch at the first floor landing. The inspection was restricted to a head and shoulder inspection and due to the presence to the presence of insulation and stored items.</p>
<b>Rainwater fittings</b>	<p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p>The gutters and downpipes are of cast iron and plastic construction.</p>
<b>Main walls</b>	<p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p><b>Foundations and concealed parts were not exposed or inspected.</b></p> <p>The main walls are traditional solid stone construction.</p>
<b>Windows, external doors and joinery</b>	<p><b>Internal and external doors were opened and closed where keys were available.</b></p> <p><b>Random windows were opened and closed where possible.</b></p> <p><b>Doors and windows were not forced open.</b></p> <p>The windows are a combination of timber double glazed and single glazed construction. There is a double glazed timber Velux window installed within the utility room. The access doors are of timber and timber/double glazed construction.</p>
<b>External decorations</b>	<p><b>Visually inspected.</b></p> <p>External metalwork and timbers are paint finished.</p>
<b>Conservatories / porches</b>	NOT APPLICABLE
<b>Communal areas</b>	NOT APPLICABLE

# Single Survey

<b>Garages and permanent outbuildings</b>	<p><b>Visually inspected.</b></p> <p>There is a lean to structure installed to the rear elevation of timber construction beneath a polycarbonate roof.</p>
<b>Outside areas and boundaries</b>	<p><b>Visually inspected.</b></p> <p>The property benefits from private garden ground to front and rear. The boundaries are of stone construction.</p>
<b>Ceilings</b>	<p><b>Visually inspected from floor level.</b></p> <p>The ceilings are of lath and plaster and plasterboard construction.</p>
<b>Internal walls</b>	<p><b>Visually inspected from floor level.</b></p> <p><b>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</b></p> <p>The internal walls are of lath and plaster and timber stud construction with plasterboard finishes.</p>
<b>Floors including sub floors</b>	<p>The floors are ground floor level are of suspended timber and solid design. The first floor flooring is of suspended timber construction. Part fitted floor coverings restricted the inspection.</p> <p>No access was gained to any sub floor areas.</p>
<b>Internal joinery and kitchen fittings</b>	<p><b>Built-in cupboards were looked into but no stored items were moved.</b></p> <p><b>Kitchen units were visually inspected excluding appliances.</b></p> <p>The skirtings, facings and door surrounds are of timber construction. The internal pass doors are of timber design with some incorporating glazing.</p> <p>The kitchen provides an adequate amount of wall and floor mounted units with worktop surfaces.</p> <p>The utility room comprises an adequate amount of wall and floor mounted units.</p>
<b>Chimney breasts and fireplaces</b>	<p><b>Visually inspected.</b></p> <p><b>No testing of the flues or fittings was carried out.</b></p> <p>There is a gas fireplace installed within the living room. Elsewhere the fireplaces have been blocked.</p>


# Single Survey

Internal decorations	<p><b>Visually inspected.</b></p> <p>Internal decorations are based on emulsion paint, tiling and timber panelling.</p>
Cellars	NOT APPLICABLE
Electricity	<p><b>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b></p> <p>Mains supply. The electrical switchgear is located within the vestibule.</p>
Gas	<p><b>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b></p> <p>Mains supply.</p>
Water, plumbing, bathroom fittings	<p><b>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>Mains supply. Where visible internal distribution pipes are of copper and plastic construction. The sanitary arrangements comprise a three piece bathroom suite.</p> <p>There is a sink installed within the box room.</p>
Heating and hot water	<p><b>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>Central heating and hot water is by way of a gas fired boiler serving radiators located throughout the property. The gas boiler is located within the cupboard beneath the stair. The hot water is assumed supplied on a direct demand basis via the central heating system.</p>

# Single Survey

<b>Drainage</b>	<p><b>Drainage covers etc were not lifted.</b></p> <p><b>Neither drains nor drainage systems were tested.</b></p> <p>Assumed mains drainage to the public sewer.</p>
<b>Fire, smoke and burglar alarms</b>	<p><b>Visually inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>Smoke detection devices were noted.</p> <p>New smoke alarm standards were introduced in Scotland in February 2022 and it is likely that some properties may require additional works to meet these standards. In instances where alarms are in place, no tests whatsoever have been carried out and we cannot confirm if the system complies with the most recent regulations. Any potential purchaser should satisfy themselves as to whether the current system meets with regulations or otherwise.</p>
<b>Any additional limits to inspection</b>	<p>It is outwith the scope of this inspection to determine whether or not asbestos based products are present within the property. Asbestos was widely used in the building industry until around 1999, when it became a banned substance. If you have any concerns you should engage the services of a qualified asbestos surveyor.</p> <p>No inspection for Japanese Knotweed was carried out and unless otherwise stated for the purpose of this report, it is assumed that there is no Japanese Knotweed within the boundaries of the property or neighbouring properties.</p> <p>Insulation has been laid over the roof joists and accordingly a head and shoulders inspection of the roof space was possible only.</p> <p>The property was heavily furnished at the time of our inspection and the services were not tested.</p> <p>No access was obtained to sub-floor areas.</p> <p>A restricted inspection was possible only of the roof and chimneys from ground level.</p> <p>Restricted inspection in cupboards due to storage items.</p> <p>Not all the windows were tested.</p> <p>Our inspection was restricted to the exposed and accessible surface fabric.</p> <p>No inspection of any flat roof structure.</p>

## Sectional Diagram showing elements of a typical house

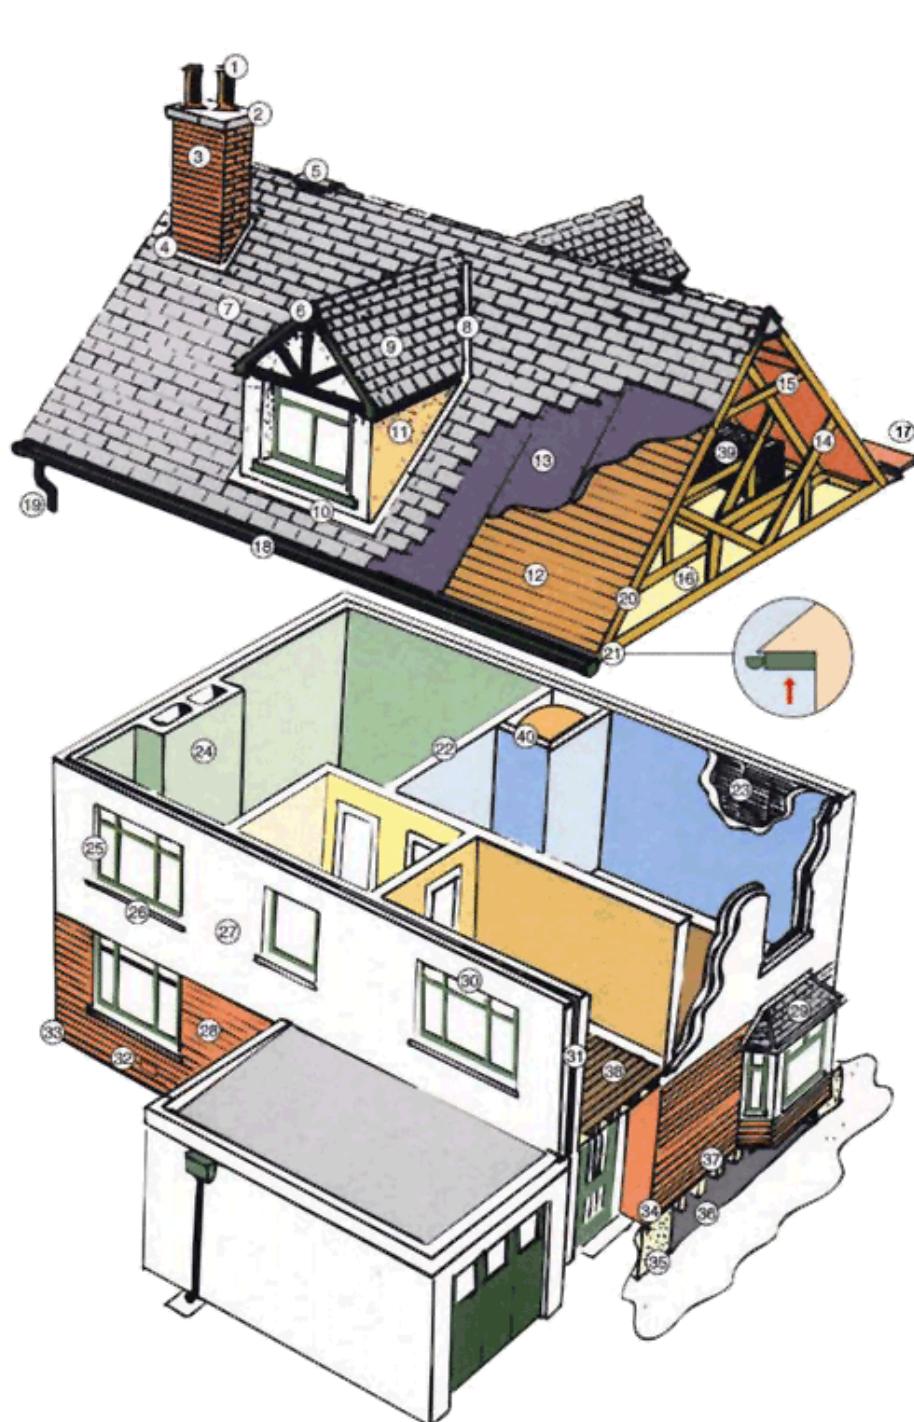

- 1 Chimney pots
- 2 Coping stone
- 3 Chimney head
- 4 Flashing
- 5 Ridge ventilation
- 6 Ridge board
- 7 Slates / tiles
- 8 Valley guttering
- 9 Dormer projection
- 10 Dormer flashing
- 11 Dormer cheeks
- 12 Sarking
- 13 Roof felt
- 14 Trusses
- 15 Collar
- 16 Insulation
- 17 Parapet gutter
- 18 Eaves guttering
- 19 Rainwater downpipe
- 20 Verge boards /skews
- 21 Soffit boards
- 22 Partition wall
- 23 Lath / plaster
- 24 Chimney breast
- 25 Window pointing
- 26 Window sills
- 27 Rendering
- 28 Brickwork / pointing
- 29 Bay window projection
- 30 Lintels
- 31 Cavity walls / wall ties
- 32 Subfloor ventilator
- 33 Damp proof course
- 34 Base course
- 35 Foundations
- 36 Solum
- 37 Floor joists
- 38 Floorboards
- 39 Water tank
- 40 Hot water tank

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

# Single Survey

## 2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

 Structural movement	
<b>Repair category</b>	1
<b>Notes</b>	There is evidence of settlement in the building noted both internally and externally but this is not inconsistent with a property of this age and type and on the basis of a single inspection appears to be longstanding.

 Dampness, rot and infestation	
<b>Repair category</b>	2
<b>Notes</b>	Above average readings were noted to the lower section of chimney breast within the kitchen/Dining. All remedial repairs should be undertaken.

 Chimney stacks	
<b>Repair category</b>	1
<b>Notes</b>	These appeared generally in fair condition consistent with age, sections of weathering noted in line with age. We have had sight of Chimney Scotland Paul McLenaghan & Son documentation outlining works carried out in 2024. The purchaser should satisfy themselves with this documentation.

 Roofing including roof space	
<b>Repair category</b>	2
<b>Notes</b>	<p>Localised slipped/chipped slates noted. The roof covering is now of an age where ongoing repair and regular maintenance will be required and it would be prudent to seek the advice of a roofing contractor to comment on its current condition and expected lifespan.</p> <p>The glass cupola within the hallway show signs of weathering and ongoing maintenance should be anticipated.</p> <p>The flat roof structures from ground level were not visible and ongoing maintenance and repair should be anticipated. It should be appreciated that flat roof coverings have a limited life only and require above average maintenance.</p>

# Single Survey

	<b>Roofing including roof space</b>
<b>Repair category</b>	2
<b>Notes</b>	<p>Any information as to its last renewal date should be obtained, if available.</p> <p>There is evidence of condensation noted to timbers within the roof space.</p>
	<b>Rainwater fittings</b>
<b>Repair category</b>	2
<b>Notes</b>	<p>There is evidence of corrosion to sections of the cast iron fitments which could lead to leakage. Ongoing maintenance and repairs should be envisaged.</p>
	<b>Main walls</b>
<b>Repair category</b>	2
<b>Notes</b>	<p>The stonework is weathered and attention is required to pointing. Repairs in this regard should be envisaged as part of an ongoing maintenance programme.</p>
	<b>Windows, external doors and joinery</b>
<b>Repair category</b>	2
<b>Notes</b>	<p>Localised sections of deterioration noted to mastic pointing.</p> <p>There is evidence of a cracked glass pane within the box room.</p> <p>Some sash cords were noted to be missing/defective.</p> <p>Some external timbers were showing signs of weathering and deterioration, we have been informed by the vendor that these are due to be sanded and painted and this should be confirmed.</p>
	<b>External decorations</b>
<b>Repair category</b>	2
<b>Notes</b>	<p>The external decoration is weathered and repairs should be expected.</p>
	<b>Conservatories/porches</b>
<b>Repair category</b>	-
<b>Notes</b>	NOT APPLICABLE

# Single Survey

	<b>Communal areas</b>
<b>Repair category</b>	-
<b>Notes</b>	NOT APPLICABLE
	<b>Garages and permanent outbuildings</b>
<b>Repair category</b>	-
<b>Notes</b>	NOT APPLICABLE
	<b>Outside areas and boundaries</b>
<b>Repair category</b>	2
<b>Notes</b>	Boundaries show signs of weathering and defective pointing, ongoing repairs and maintenance should be anticipated.
	<b>Ceilings</b>
<b>Repair category</b>	2
<b>Notes</b>	Cracking and blemishes have occurred and some plaster repairs may be required.  There was evidence of blemishes noted to the ceiling within the front bedroom and to bay window section within the living-room. These areas could not be tested due to items within the room.
	<b>Internal walls</b>
<b>Repair category</b>	1
<b>Notes</b>	Cracking and blemishes have occurred and some plaster repairs may be required.
	<b>Floors including sub-floors</b>
<b>Repair category</b>	1
<b>Notes</b>	Areas of loose/ uneven flooring were noted.

# Single Survey

	<b>Internal joinery and kitchen fittings</b>
<b>Repair category</b>	1
<b>Notes</b>	<p>The internal joinery is generally in keeping with the age and type of property and appeared in fair condition consistent with age.</p> <p>The kitchen fittings are generally in adequate condition for their age and type however sections of wear and tear were noted.</p> <p>The utility room unit shows signs of wear and tear.</p> <p>Some internal pass doors incorporate glazing and it has not been checked or tested as safety glass.</p>
	<b>Chimney breasts and fireplaces</b>
<b>Repair category</b>	1
<b>Notes</b>	<p>The gas fire was not tested. A copy of servicing history documentation should be obtained prior to purchase. This is assumed to be in order.</p> <p>All flue linings should be checked, repaired if necessary and swept prior to the fires being reused.</p> <p>All other fireplaces have been removed/blocked and we assume adequately vented.</p> <p>We refer you to comments in the damp section.</p>
	<b>Internal decorations</b>
<b>Repair category</b>	1
<b>Notes</b>	The property appears in fair decorative. We have been informed that new carpets have been fitted to hall, stair and landing.
	<b>Cellars</b>
<b>Repair category</b>	-
<b>Notes</b>	NOT APPLICABLE
	<b>Electricity</b>
<b>Repair category</b>	2
<b>Notes</b>	The electrical installation is dated and as such we recommend that it be checked and upgraded as necessary by an NICEIC registered Electrical Contractor.

# Single Survey

 <b>Gas</b>	
<b>Repair category</b>	1
<b>Notes</b>	In the interest of safety all gas appliances should be checked by a Gas Safe Registered Engineer.
 <b>Heating and hot water</b>	
<b>Repair category</b>	1
<b>Notes</b>	There is a gas fired central heating system and gas fittings and these should all be checked and serviced in the normal manner. In the interests of safety it would be prudent to have all gas appliances checked by a Gas Safe registered tradesman. The radiators are of mixed age and type and some upgrading should be anticipated.
 <b>Drainage</b>	
<b>Repair category</b>	1
<b>Notes</b>	The property is thought to be connected to a main sewer. There was no surface evidence to suggest the system is choked or leaking.

# Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	2
Chimney stacks	1
Roofing including roof space	2
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	2
External decorations	2
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	-
Outside areas and boundaries	2
Ceilings	2
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	-
Electricity	2
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

## Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

## Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

## 3. Accessibility information

### Guidance notes on accessibility information

*Three steps or fewer to a main entrance door of the property:*

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

*Unrestricted parking within 25 metres:*

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

<b>1. Which floor(s) is the living accommodation on?</b>	Ground & First	
<b>2. Are there three steps or fewer to a main entrance door of the property?</b>	Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>
<b>3. Is there a lift to the main entrance door of the property?</b>	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>
<b>4. Are all door openings greater than 750mm?</b>	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>
<b>5. Is there a toilet on the same level as the living room and kitchen?</b>	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>
<b>6. Is there a toilet on the same level as a bedroom?</b>	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>
<b>7. Are all rooms on the same level with no internal steps or stairs?</b>	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>
<b>8. Is there unrestricted parking within 25 metres of an entrance door to the building?</b>	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>

# Single Survey

## 4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

### Matters for a solicitor or licensed conveyancer

Absolute ownership assumed. We are unaware of any easements, servitudes or rights of way which may adversely affect the property. This point should be confirmed by reference to the Title Deeds.

We assume that the carriageways etc. , ex adverso the subjects are the responsibility of the Local Authority. It is also assumed that any new access roads, footpaths etc. , will be private and will be brought up to adoption standards and liability thereafter will be shared according to use.

We are unaware of any adverse planning proposals affecting the subjects although this should be confirmed by obtaining a Property Enquiry Certificate.

It is recommended that when repairs, defects or maintenance items have been identified interested parties make appropriate enquiries in order to satisfy themselves of potential costs and the extent of the works required prior to submitting a legal offer to purchase.

The valuation is made on the assumption that any alterations that may have been carried out to the property satisfy all relevant legislation and have full certification where appropriate. While not necessarily an exhaustive list, alterations noted at the time of our inspection include the location of kitchen.

The property is understood to be category C listed and within a conservation area. Your legal advisor will provide further details.

We have been informed by the vendor that architect drawings are available for an attic conversion and all details in this regard should be confirmed.

### Estimated reinstatement cost for insurance purposes

It is assumed that insurance cover is obtainable on normal terms. The guidance figure is the estimate of costs for reinstating the subjects as at the date of inspection based on information provided by the Building Cost Information Service (BCIS). It is recommended that this figure is kept under regular review to ensure that you have adequate insurance cover. We are of the opinion that the subjects should be insured for buildings reinstatement purposes for a sum of not less than £680,000 (SIX HUNDRED AND EIGHTY THOUSAND POUNDS STERLING).

### Valuation and market comments

We are of the opinion that the market value of the subjects all as previously described and on a vacant possession basis would be fairly stated in the region of £600,000 (SIX HUNDRED THOUSAND POUNDS STERLING).

Signed	Security Print Code [545585 = 1644 ] Electronically signed
--------	---

Report author	Graeme Budge
---------------	--------------

# Single Survey

<b>Company name</b>	Graham + Sibbald
<b>Address</b>	40 Torphichen Street, Edinburgh, EH3 8JB
<b>Date of report</b>	27th January 2026

# Mortgage Valuation Report

## GRAHAM + SIBBALD

### Property Address

Address 5 Shandon Crescent, Polwarth, Edinburgh, EH11 1QE  
Seller's Name Mr & Mrs Prosser  
Date of Inspection 22nd January 2026

### Property Details

Property Type  House  Bungalow  Chalet  Purpose built maisonette  
 Coach  Studio  Converted maisonette  Purpose built flat  
 Converted flat  Tenement flat  Flat over non-residential use  Other (specify in General Remarks)  
Property Style  Detached  Semi detached  Mid terrace  End terrace  
 Back to back  High rise block  Low rise block  Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector,  
e.g. local authority, military, police?  Yes  No

Flats/Maisonettes only Floor(s) on which located  No. of floors in block  Lift provided?  Yes  No  
No. of units in block

Approximate Year of Construction

### Tenure

Absolute Ownership  Leasehold Ground rent £  Unexpired years

### Accommodation

Number of Rooms  Living room(s)  Bedroom(s)  Kitchen(s)  
 Bathroom(s)  WC(s)  Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings)  m<sup>2</sup> (Internal)  m<sup>2</sup> (External)

Residential Element (greater than 40%)  Yes  No

### Garage / Parking / Outbuildings

Single garage  Double garage  Parking space  No garage / garage space / parking space  
Available on site?  Yes  No

Permanent outbuildings:

None

# Mortgage Valuation Report

## Construction

Walls	<input type="checkbox"/> Brick	<input checked="" type="checkbox"/> Stone	<input type="checkbox"/> Concrete	<input type="checkbox"/> Timber frame	
	<input type="checkbox"/> Solid	<input type="checkbox"/> Cavity	<input type="checkbox"/> Steel frame	<input type="checkbox"/> Concrete block	<input type="checkbox"/> Other (specify in General Remarks)
Roof	<input type="checkbox"/> Tile	<input type="checkbox"/> Slate	<input type="checkbox"/> Asphalt	<input type="checkbox"/> Felt	
	<input type="checkbox"/> Lead	<input type="checkbox"/> Zinc	<input type="checkbox"/> Artificial slate	<input type="checkbox"/> Flat glass fibre	<input checked="" type="checkbox"/> Other (specify in General Remarks)

## Special Risks

Has the property suffered structural movement?  Yes  No

If Yes, is this recent or progressive?  Yes  No

Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity?  Yes  No

If Yes to any of the above, provide details in General Remarks.

## Service Connection

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks.

Drainage	<input checked="" type="checkbox"/> Mains	<input type="checkbox"/> Private	<input type="checkbox"/> None	Water	<input checked="" type="checkbox"/> Mains	<input type="checkbox"/> Private	<input type="checkbox"/> None
Electricity	<input checked="" type="checkbox"/> Mains	<input type="checkbox"/> Private	<input type="checkbox"/> None	Gas	<input checked="" type="checkbox"/> Mains	<input type="checkbox"/> Private	<input type="checkbox"/> None
Central Heating	<input checked="" type="checkbox"/> Yes	<input type="checkbox"/> Partial	<input type="checkbox"/> None				

Brief description of Central Heating:

Gas fired boiler.

## Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

<input type="checkbox"/> Rights of way	<input type="checkbox"/> Shared drives / access	<input type="checkbox"/> Garage or other amenities on separate site	<input type="checkbox"/> Shared service connections
<input type="checkbox"/> Agricultural land included with property		<input type="checkbox"/> Ill-defined boundaries	<input type="checkbox"/> Other (specify in General Remarks)

## Location

<input type="checkbox"/> Residential suburb	<input checked="" type="checkbox"/> Residential within town / city	<input type="checkbox"/> Mixed residential / commercial	<input type="checkbox"/> Mainly commercial
<input type="checkbox"/> Commuter village	<input type="checkbox"/> Remote village	<input type="checkbox"/> Isolated rural property	<input type="checkbox"/> Other (specify in General Remarks)

## Planning Issues

Has the property been extended / converted / altered?  Yes  No

If Yes provide details in General Remarks.

## Roads

<input checked="" type="checkbox"/> Made up road	<input type="checkbox"/> Unmade road	<input type="checkbox"/> Partly completed new road	<input type="checkbox"/> Pedestrian access only	<input type="checkbox"/> Adopted	<input type="checkbox"/> Unadopted
--	--------------------------------------	--	---	----------------------------------	------------------------------------

# Mortgage Valuation Report

## General Remarks

The property is located within the Polwarth area of Edinburgh located to the west of Edinburgh city centre where surrounding properties are broadly similar in terms of age, type and character. All local facilities and amenities can be found nearby.

Absolute ownership assumed. We are unaware of any easements, servitudes or rights of way which may adversely affect the property. This point should be confirmed by reference to the Title Deeds.

The valuation is made on the assumption that any alterations that may have been carried out to the property satisfy all relevant legislation and have full certification where appropriate. While not necessarily an exhaustive list, alterations noted at the time of our inspection include the location of kitchen.

The property is understood to be category C listed and within a conservation area. Your legal advisor will provide further details.

We have been informed by the vendor that architect drawings are available for an attic conversion and all details in this regard should be confirmed.

The property appeared in fair order in line with age and type however some ongoing maintenance, repair and upgrading should be anticipated.

There is evidence of localised dampness noted to the chimney breast within the kitchen and all remedial repairs should be undertaken.

The roof is of pitched slate and flat assumed felt construction.

## Essential Repairs

None

Estimated cost of essential repairs £  Retention recommended?  Yes  No Amount £

# Mortgage Valuation Report

## Comment on Mortgageability

In our opinion the property forms suitable security for loan purposes subject to the specific lender's criteria which may vary.

## Valuations

Market value in present condition	£ <input type="text" value="600,000"/>
Market value on completion of essential repairs	£ <input type="text"/>
Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)	£ <input type="text" value="680,000"/>
Is a reinspection necessary?	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No

## Buy To Let Cases

What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis? £

Is the property in an area where there is a steady demand for rented accommodation of this type?  Yes  No

## Declaration

Signed	Security Print Code [545585 = 1644 ]
	Electronically signed by:-
Surveyor's name	Graeme Budge
Professional qualifications	MA (Hons) MRICS
Company name	Graham + Sibbald
Address	40 Torphichen Street, Edinburgh, EH3 8JB
Telephone	0131 225 1559
Fax	
Report date	27th January 2026

# Energy Performance Certificate (EPC)

Scotland

Dwellings

5 SHANDON CRESCENT, POLWARTH, EDINBURGH, EH11 1QE

**Dwelling type:** Mid-terrace house  
**Date of assessment:** 22 January 2026  
**Date of certificate:** 26 January 2026  
**Total floor area:** 113 m<sup>2</sup>  
**Primary Energy Indicator:** 253 kWh/m<sup>2</sup>/year


**Reference number:** 2623-1004-7209-3446-8200  
**Type of assessment:** RdSAP, existing dwelling  
**Approved Organisation:** Elmhurst  
**Main heating and fuel:** Boiler and radiators, mains gas

## You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

Estimated energy costs for your home for 3 years*	£5,616	See your recommendations report for more information
Over 3 years you could save*	£1,317	

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

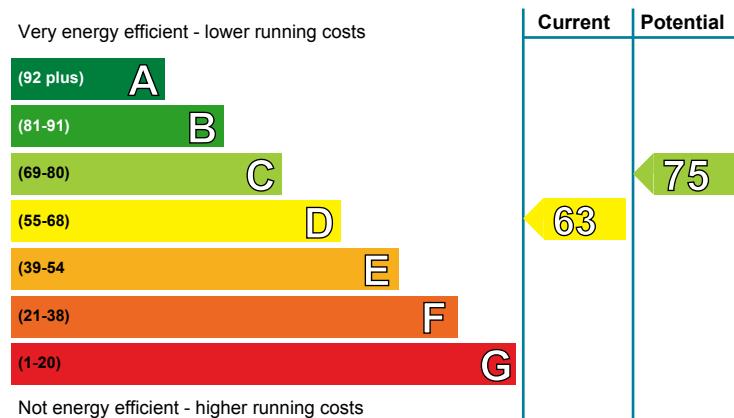


## Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (63)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

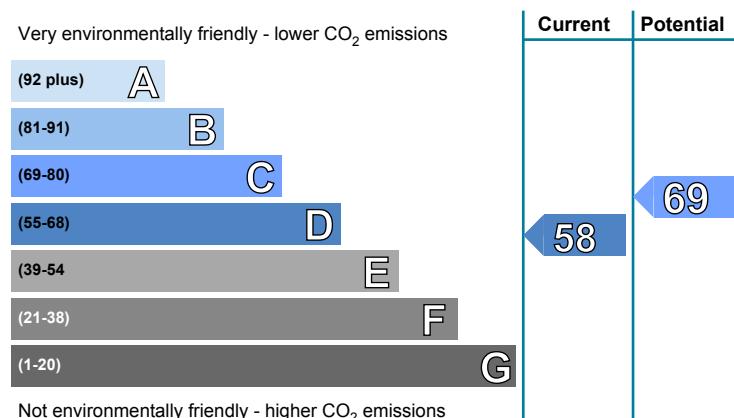

## Environmental Impact (CO<sub>2</sub>) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO<sub>2</sub>) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band D (58)**

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

## Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal wall insulation	£7,500 - £11,000	£621.00
2 Floor insulation (suspended floor)	£5,000 - £10,000	£297.00
3 Draughtproofing	£150 - £250	£138.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit [greenerscotland.org](http://greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

## Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	Pitched, 125 mm loft insulation	★★★☆☆	★★★☆☆
Floor	Suspended, no insulation (assumed)	—	—
Windows	Partial double glazing	★☆☆☆☆	★☆☆☆☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, TRVs and bypass	★★★☆☆	★★★☆☆
Secondary heating	Room heaters, mains gas	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Below average lighting efficiency	★☆☆☆☆	★☆☆☆☆

## The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.

## The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 46 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 5.2 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 1.4 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

## Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£4,695 over 3 years	£3,477 over 3 years	
Hot water	£612 over 3 years	£612 over 3 years	
Lighting	£309 over 3 years	£210 over 3 years	
<b>Totals</b>	<b>£5,616</b>	<b>£4,299</b>	 You could save £1,317 over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

## Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Internal wall insulation	£7,500 - £11,000	£207	<span style="background-color: yellow;">D 67</span>	<span style="background-color: blue;">D 64</span>
2 Floor insulation (suspended floor)	£5,000 - £10,000	£99	<span style="background-color: green;">C 69</span>	<span style="background-color: blue;">D 66</span>
3 Draughtproofing	£150 - £250	£46	<span style="background-color: green;">C 70</span>	<span style="background-color: blue;">D 67</span>
4 Low energy lighting for all fixed outlets	£120 - £140	£28	<span style="background-color: green;">C 70</span>	<span style="background-color: blue;">D 67</span>
5 Upgrade heating controls	£220 - £250	£58	<span style="background-color: green;">C 71</span>	<span style="background-color: blue;">C 69</span>
6 Solar photovoltaic panels, 2.5 kWp	£8,000 - £10,000	£223	<span style="background-color: green;">C 75</span>	<span style="background-color: blue;">C 69</span>

## Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to [www.greenerscotland.org](http://www.greenerscotland.org).

## About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

### 1 Internal wall insulation

Internal wall insulation involves adding a layer of insulation to the inside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. Further information can be obtained from the National Insulation Association ([www.nationalinsulationassociation.org.uk](http://www.nationalinsulationassociation.org.uk)).

### 2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including [www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation](http://www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation). Building regulations generally apply to this work so it is best to check with your local authority building standards department.

### 3 Draughtproofing

Fitting draughtproofing, strips of insulation around windows and doors, will improve the comfort in the home. A contractor can be employed but draughtproofing can be installed by a competent DIY enthusiast.

### 4 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (<http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting>).

### 5 Heating controls (room thermostat)

The heating system should have a room thermostat to enable the boiler to switch off when no heat is required. A competent heating engineer should be asked to do this work. Insist that the thermostat switches off the boiler as well as the pump and that the thermostatic radiator valve is removed from any radiator in the same room as the thermostat. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

### 6 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at [www.microgenerationcertification.org](http://www.microgenerationcertification.org).

## Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

**LZC energy sources present:** There are none provided for this home

## Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	16,166.27	N/A	N/A	N/A
Water heating (kWh per year)	2,753.37			

## Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

## About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst ([www.elmhurstenergy.co.uk](http://www.elmhurstenergy.co.uk)), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk) and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Graeme Budge
Assessor membership number:	EES/018254
Company name/trading name:	Graham & Sibbald
Address:	40 Torphichen Street Edinburgh EH3 8JB
Phone number:	0131 225 1559
Email address:	<a href="mailto:edinburgh@g-s.co.uk">edinburgh@g-s.co.uk</a>
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

## Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk), with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at [www.gov.scot/epc](http://www.gov.scot/epc).

## Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greenerscotland.org](http://greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG  
**0808 808 2282**  
FUNDED BY THE SCOTTISH GOVERNMENT



# Property Questionnaire

<b>Property Address</b>	5 Shandon Crescent Edinburgh EH11 1QE
-------------------------	---

<b>Seller(s)</b>	Mr and Mrs Prosser
------------------	--------------------

<b>Completion date of property questionnaire</b>	19/01/2026
--	------------

## 1 Length of ownership

How long have you owned the property?

19 years 1 month

## 2 Council tax

Which Council Tax band is your property in?

F

## 3 Parking

What are the arrangements for parking at your property?

(Please tick all that apply)

Garage	<input type="checkbox"/>
Allocated parking space	<input type="checkbox"/>
Driveway	<input type="checkbox"/>
Shared parking	<input type="checkbox"/>
On street	<input type="checkbox"/>
Resident permit	<input checked="" type="checkbox"/>
Metered parking	<input type="checkbox"/>

Other (please specify)

## 4 Conservation area

Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?

Yes

## 5 Listed buildings

Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?

No

## 6 Alterations/additions/extensions

a.(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?

Yes

If you have answered yes, please describe below the changes which you have made:

I have built a lean to extension as a 'catio'. We have had plans drawn up for building into the Attic but haven't yet.

(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?

No

If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.

If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:

b. Have you had replacement windows, doors, patio doors or double glazing installed in your property?

No

If you have answered yes, please answer the three questions below:

- (i) Were the replacements the same shape and type as the ones you replaced?
- (ii) Did this work involve any changes to the window or door openings?
- (iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):

Please give any guarantees which you received for this work to your solicitor or estate agent.

## 7 Central heating

- a. Is there a central heating system in your property?

(Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).

Yes

If you have answered yes or partial — what kind of central heating is there?

(Examples: gas-fired, solid fuel, electric storage heating, gas warm air).

gas fired

If you have answered yes, please answer the three questions below:

- (i) When was your central heating system or partial central heating system installed?

Don't know

- (ii) Do you have a maintenance contract for the central heating system?

No

If you have answered yes, please give details of the company with which you have a maintenance contract:

- (iii) When was your maintenance agreement last renewed?

(Please provide the month and year).

## 8 Energy Performance Certificate

Does your property have an Energy Performance Certificate which is less than 10 years old?

No

## 9 Issues that may have affected your property

- a. Has there been any storm, flood, fire or other structural damage to your property while you have owned it?

No

If you have answered yes, is the damage the subject of any outstanding insurance claim?

- b. Are you aware of the existence of asbestos in your property?

No

If you have answered yes, please give details:

## 10 Services

Please tick which services are connected to your property and give details of the supplier:

<b>Services</b>	<b>Connected Supplier</b>
-----------------	---------------------------

Gas or liquid petroleum gas	<input checked="" type="checkbox"/> Fuse
Water mains or private water supply	<input checked="" type="checkbox"/> Council
Electricity	<input checked="" type="checkbox"/> Fuse
Mains drainage	<input checked="" type="checkbox"/> Council
Telephone	<input type="checkbox"/>
Cable TV or satellite	<input type="checkbox"/>
Broadband	<input checked="" type="checkbox"/> EE

b. Is there a septic tank system at your property?

No

(i) Do you have appropriate consents for the discharge from your septic tank?

(ii) Do you have a maintenance contract for your septic tank?

If you have answered yes, please give details of the company with which you have a maintenance contract:

## **11 Responsibilities for shared or common areas**

a. Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?

No

If you have answered yes, please give details:

b. Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?

No

If you have answered yes, please give details:

c. Has there been any major repair or replacement of any part of the roof during the time you have owned the property?

No

d. Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries?

No

If you have answered yes, please give details:

e. As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?

No

If you have answered yes, please give details:

f. As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)

No

If you have answered yes, please give details:

## **12 Charges associated with your property**

a. Is there a factor or property manager for your property?

No

b. Is there a common buildings insurance policy?

No

If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?

c. Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.

## **13 Specialist works**

a. As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?

No

If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.

b. As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?

No

If you have answered yes, please give details:

c. If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?

If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate., these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.

Guarantees are held by:

## **14 Guarantees**

a. Are there any guarantees or warranties for any of the following:

(i) Electrical work

No

(ii) Roofing

No

(iii) Central heating  
No

(iv) National House Building Council (NHBC)  
No

(v) Damp course  
No

(vi) Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)  
No

b. If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):

(i) Electrical work

(ii) Roofing

(iii) Central heating

(iv) National House Building Council (NHBC)

(v) Damp course

(vi) Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)

c. Are there any outstanding claims under any of the guarantees listed above?  
No  
If you have answered yes, please give details:

## **15 Boundaries**

So far as you are aware, has any boundary of your property been moved in the last 10 years?

No

If you have answered yes, please give details:

## **16 Notices that affect your property**

In the past three years have you ever received a notice:

a. advising that the owner of a neighbouring property has made a planning application?  
No

b. that affects your property in some other way?  
No

c. that requires you to do any maintenance, repairs or improvements to your property?  
No

If you have answered yes to any of a–c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.